TILE BRIDGE – PERMANENT TILE REPAIR

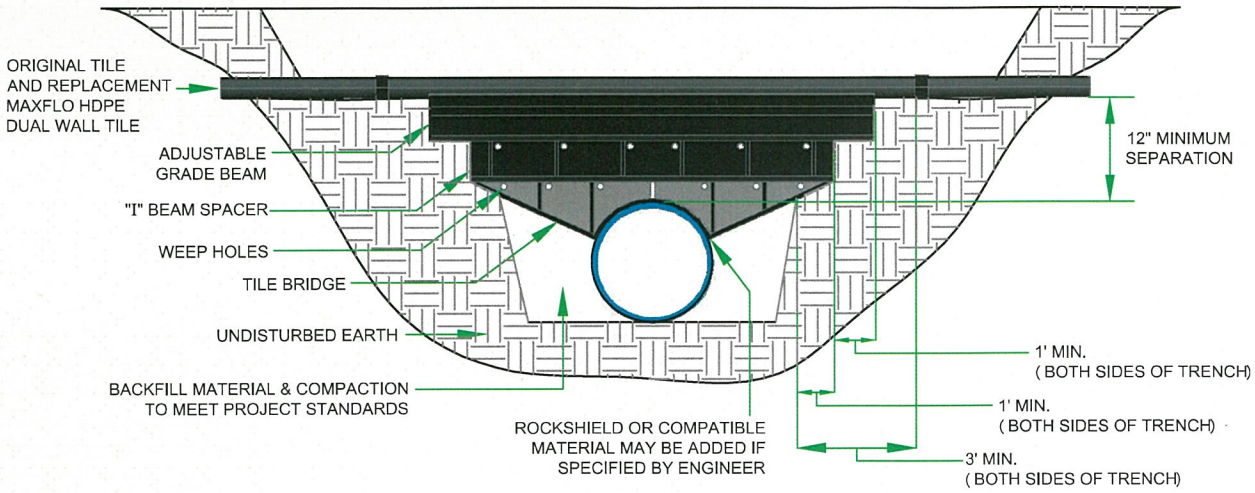

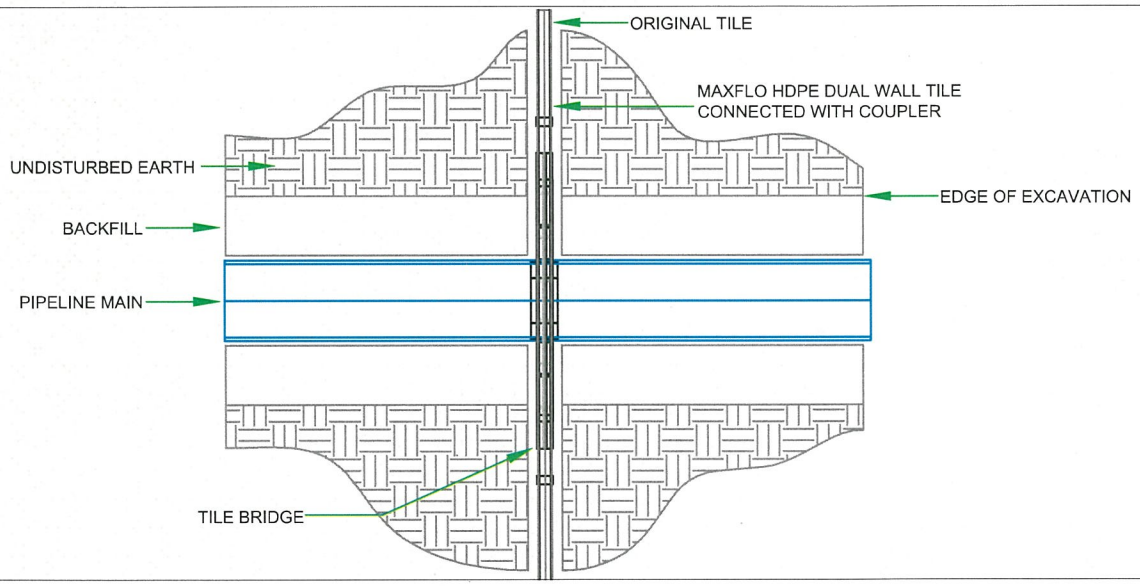

NOTES:

1. TILE REPAIR AND REPLACEMENT SHALL CROSS PERPENDICULAR TO THE PIPELINE WHILE MAINTAINING GRADIENT AND FLOW. WATER FLOW MUST BE EQUAL TO OR GREATER THAN ORIGINAL TILE CAPACITY. THE MINIMUM RECEIVING TILE SIZE REQUIRED FOR THE REPAIR SHALL BE 4"DUAL WALL WHEN CONNECTING TO 2", 3" OR 4" SINGLE WALL FIELD TILE AND 6" DUAL WALL WHEN CONNECTING TO 5" AND 6" SINGLE WALL FIELD TILE AND SO ON. ALL RECEIVING TILE SHALL BE DUAL WALL PERFORATED HDPE TUBING AND APPURTENANCES.

2. THE TILE BRIDGE SUPPORTING STRUCTURE SHALL PROVIDE A MINIMUM OF 1 LF SUPPORT INTO UNDISTURBED SOIL IN EACH TRENCH WALL. EACH ADDITIONAL SUPPORTING STRUCTURE SECTION SHALL ALSO PROVIDE A MINIMUM OF 1 LF SUPPORT INTO UNDISTURBED SOIL, INCLUDING ADJUSTABLE GRADE BEAM (WHICH INCLUDES "Y" SUPPORT STRUCTURE FOR PIPE) AND REPLACEMENT HDPE DUAL WALL. IN LOOSER, LESS STRUCTURED SOILS MORE PRONE TO SLOUGHING OFF, THESE SUPPORT DISTANCES MAY NEED TO BE INCREASED. REPLACEMENT HDPE DUAL WALL MAY BE ZIP TIED TO THE "Y" SECTION OF THE ADJUSTABLE GRADE BEAM. THE "Y" SECTION OF ADJUSTABLE GRADE BEAM SHALL SUPPORT HDPE DUAL WALL TO ASTM F449 STANDARDS. SPACER BEAMS MAY BE UTILIZED IF GREATER ELEVATION IS NEEDED BETWEEN THE TILE BRIDGE AND ADJUSTABLE GRADE BEAM TO MAINTAIN PROPER LINE AND GRADE. IF OVER DIGGING INTO THE UNDISTURBED SOIL INTENDED TO SUPPORT THE STRUCTURE OCCURS DURING INSTALLATION OF THE SUPPORTING STRUCTURE, THIS OVER DIG MAY BE FILLED WITH SAND FILLED OR SAKRETE BAGS PROVIDED THEY FIRMLY ABUT ADDITIONAL BAGS AND THE SIDEWALL OF THE TRENCH. IF THE TILE MUST BE RELOCATED, THE INSTALLATION ANGLE SHALL BE PERPENDICULAR TO THE PIPELINE DIRECTION.

3. THE DRAIN TILE REPAIR SECTION WILL BE PERMANENTLY CONNECTED TO THE EXISTING DRAIN TILE A MINIMUM OF 1 LF OUTSIDE OF THE UPPERMOST SUPPORTING STRUCTURE USING INDUSTRY STANDARDS TO ENSURE PROPER SEAL OF REPAIRED DRAIN TILES.

4. OTHER METHODS OF PERMANENT DRAIN TILE REPAIR SUPPORTS MAY BE USED IF THE PROPOSED METHOD IS OF EQUAL OR GREATER STRENGTH THAN DETAILED ABOVE. ANY ALTERNATE METHODS, INCLUDING "TIE IN" AREAS OR OTHER AREAS REQUIRING LONGER SPANS OF SUPPORT, SHALL CONTAIN ADEQUATE AND CONTINUOUS METHODS OF SUPPORT FROM UNDISTURBED TRENCH BOTTOM SOIL VERTICALLY TO THE SUPPORT STRUCTURE AND THROUGHOUT ITS LENGTH. ALTERNATE SUPPORTS SHALL BE APPROVED BY COMPANY REPRESENTATIVES AND LAND OWNERS IN ADVANCE.

5. ALL MATERIALS SHALL BE FURNISHED BY THE PROJECT OWNER AND OR CONTRACTOR.

6. PRIOR TO REPAIRING TILE, CONTRACTOR SHALL PROBE LATERALLY INTO THE EXISTING TILE THE FULL WIDTH OF THE RIGHT OF WAY TO DETERMINE IF ADDITIONAL DAMAGE HAS OCCURRED. USE OF ACCEPTED VIDEO CAMERA EQUIPMENT FOR INTERNAL INSPECTION MAY ALSO BE CONSIDERED. ALL DAMAGED/DISTURBED TILE SHALL BE REPAIRED AS NEAR AS PRACTICABLE TO ITS ORIGINAL OR BETTER CONDITION.

TILE BRIDGE PERMANENT TILE REPAIR	DRAWN BY: BMH DATE: 2/25/2014 SCALE: NTS SHEET: 1 OF 1